

# SURFACE ROUGHNESS GAGE

**Model No. SRG-2000**

## *INSTRUCTION MANUAL*



*Manual should be read prior to operation!*

# CONTENTS

1) GENERAL	3
2) WORK PRINCIPLE AND STRUCTURE FEATURES	3
3) MAJOR TECHNICAL PARAMETERS	4
4) USE AND OPERATION	5
5) MAINTENANCE AND REPAIR	6
<u>APPENDIX: RECOMMENDED SAMPLING LENGTH</u>	7

## 1) GENERAL

The Phase II model no. **SRG-2000** Mini Surface Roughness Tester is a next generation of product developed for the Phase II Metrology Group that features high accuracy, a wide range of application, simple operation and stable performance. It is widely applicable in testing surfaces of all kinds of metals and non-metals. Integrating the sensor with its mainframe, its a hand-held set especially suited for use on any production site.

## 2) WORKING PRINCIPLE AND STRUCTURE FEATURES

### 2.1) WORKING PRINCIPLE

When the motorized sensor is making a linear uniform motion along the test surface, the contact stylus being perpendicular to the work surface, moves up and down with the work surface. Its motion is converted into electric signals, which are amplified, filtered and transformed into digital signals through a/d. The signals are then processed by the CPU into **Ra** and **Rz** values before being displayed on the screen.

### 2.2) STRUCTURAL FEATURES

2.2A) BASIC SETUP: FOR OUTWARD APPEARANCE, SEE FIGURE 1.

Base Instrument	1 UNIT
Battery Charger	1 UNIT
Calibration Standard/Base	1 UNIT



**NEW!**  
**Small Round Parts Vise**  
Now check surface finish on these difficult  
to test parts with your SRG-2000!  
**Part No. SRG2000-VISE**



FIGURE 2: STRUCTURE OF MAINFRAME

- 1) Start Test Button
- 3) Scale Selection / Up
- 5) Power Switch
- 7) Stylus Mark

- 2) Lcd Screen
- 4) Inch/Metric Conversion / Down
- 6) Charging Socket
- 8) Stylus Protective Guard


### 3) MAJOR TECHNICAL PARAMETERS


<b>ROUGHNESS PARAMETERS</b>	Ra, Rz, Rq, Rt
<b>MEASURING RANGE</b>	RA: <b>0.05-10.0μM</b> RZ: <b>0.1 - 50μM</b> Rq : <b>0.05 ~ 10.0μm</b> Rt: <b>0.1 ~ 50μm</b>
<b>CUT-OFF LENGTHS</b>	0.25, 0.80, 2.50
<b>FILTER</b>	RC ANALOG
<b>TRACING LENGTH</b>	0.23IN (6MM)
<b>TRACING SPEED</b>	0.04IN/SECOND (1.0MM/SECOND)
<b>ACCURACY</b>	+/-12% of known value
<b>PICK UP STYLUS</b>	PIEZO-ELECTRIC
<b>TRACER TIP</b>	DIAMOND, RADIUS 10μM +/- 1μM
<b>OPERATING TEMPERATURE</b>	32-104 DEGREES F (0-40 DEGREES C)
<b>POWER</b>	3.7v Lithium ion Battery
<b>CONTACT FORCE ON PROBE</b>	<0.5N
<b>STATIC MEASURING FORCE OF SENSOR STYLUS</b>	< 0.016N
<b>DIMENSIONS</b>	106 X 70 X 24mm
<b>WEIGHT</b>	0.4LBS (200G)


### 4) USE AND OPERATION

#### 4.1) OPERATION:


POWER ON THE DEVICE.

Press and hold the Red Power button  on the front panel for 1 second. After a “beep” sound, the device is ready to work. The large LCD display will show the measuring parameters and sampling length of the previous test. Before taking a test, choose the desired parameter **Ra, Rz, Rq, or Rt** and proper sampling length **2.5, 0.8** or **0.25** (for sampling length option, consult the appendix).

After switching on the device, press the  to change parameters.

To choose the proper sampling length, press the keypad  (0.25, 0.8 OR 2.5).

After the parameters and sampling lengths are taken, you may begin testing. Position the

 mark over the test area and press the start button on top of the unit. The stylus moves automatically. When the device beeps twice, the measurement has been completed and the results will be shown upon the LCD screen.

### **POINTS FOR ATTENTION:**

While the stylus is in motion, you must keep the device even and steady so as not to affect the accuracy of the reading.

Before the sensor returns to the original position, the device will not respond to any operation until the measurement is completed.

### **4.2) CALIBRATION**

When abnormal errors are found, the standard sample block may be used for calibration. The **Ra** values of the sample block used for calibration, range from 0.1  $\mu\text{M}$  - 10 $\mu\text{M}$ .

**METHOD:** with the tester in metric mode and the power off, press the red Start button on top while pressing the Power button together. When a beep sounds, release the button and the device enters its calibration mode. The LCD screen should read "**CAL**" and there will be a Ra value on the display. If this value doesn't match your test sample then you must adjust it by pressing the up/down arrow buttons on the keypad. Press the Start button on top and the unit will begin calibrating itself. The value displayed at the end of this process should fall within the allowable tolerance of your test sample. To complete the process. Power the unit off. This will now save the new calibration. Normal measurements can resume at this time.

### **4.3) CONVERTING IN/MM**



Press and hold the keypad for about 1 second. The system will convert from Metric to English or English to Metric

### **4.5) LOW VOLTAGE INDICATOR**

When the battery symbol is near empty then its time to recharge the SRG-2000. The tester must be recharged before further usage.

### **4.6) RECHARGING**

Plug the charger into the socket of the tester. A full recharge should take between 3-5 hours. If needed, the tester can function while charging.

## **5) MAINTENANCE AND REPAIR**

### **5.1) MAINTENANCE**

Avoid collision, violent shock, heavy dust, dampness, oil and a strong magnetic field.

The Piezo-electric pick up stylus with diamond tip is extremely sensitive and accurate. After each use, make sure that the supplied protective cover goes on this tip after each use. Damage to this tip will result in false and erroneous readings.

### **5.2) REPAIR**

#### **ALL REPAIRS MUST BE DONE THROUGH THE PHASE II SERVICE DEPARTMENT.**

A return authorization number must be mandatory in order for a defective tester to be accepted for repair and/or replacement. All testers must be accompanied by your warranty card or serial number. Complete description of problem and a contact person for authorization of repairs must be supplied as well.

**ANY ATTEMPT AT HOME REPAIR WILL AUTOMATICALLY VOID THE STATED WARRANTY! NO EXCEPTIONS!**

## **Appendix: Recommended Sampling Length.**

<b>Ra (µm)</b>	<b>Rz (µm)</b>	<b>SAMPLING LENGTH</b>
>40 - 80	>160 - 320	8
>20 - 40	>80 - 160	8
>10 - 20	>40 - 80	8
>5 - 10	20 - 40	2.5
>2.5 - 5	>10 - 20	2.5
>1.25 - 2.5	>6.3 - 0	0.8
>0.63 - 1.25	>3.2 - 6.3	0.8
>0.32 - 0.63	>1.6 - 3.2	0.8
>0.25 - 0.32	>1.25 - 1.6	0.25
>0.20 - 0.25	>1.0 - 1.25	0.25
>0.16 - 0.20	>0.8 - 1.0	0.25
>0.125 - 0.16	>0.63 - 0.8	0.25
>0.1 - 0.125	>0.5 - 0.63	0.25
>0.08 - 0.1	>0.4 - 0.5	0.25
>0.063 - 0.08	>0.32 - 0.4	0.25
>0.05 - 0.063	>0.25 - 0.32	0.25
>0.04 - 0.05	>0.2 - 0.25	0.25
>0.032 - 0.04	>0.16 - 0.2	0.25
>0.025 - 0.032	>0.125 - 0.16	0.25
>0.02 - 0.025	>0.1 - 0.125	0.25
>0.016 - 0.02	>0.08 - 0.1	0.08
>0.0125 - 0.016	>0.063 - 0.08	0.08
>0.01 - 0.0125	>0.5 - 0.063	0.08
>0.008 - 0.01	>0.04 - 0.05	0.08
>0.0063 - 0.008	>0.032 - 0.04	0.08
<0.0063	<0.032	0.08

# Global Connections



## **Main Headquarters: U.S.A**

### **Phase II Machine & Tool, Inc.**

21 Industrial Ave  
Upper Saddle River, NJ. 07458 USA  
Tel: (201) 962-7373  
Fax: (201) 962-8353  
General E-Mail: [info@phase2plus.com](mailto:info@phase2plus.com)

## **BEIJING, CHINA**

### **Phase II Measuring Instruments (Beijing) Ltd.**

Room 301, Bldg 2 Qing Yuan Xi Li, Haidian District, Beijing 100192, China  
Tel: +86-10-59792409  
Fax: +86-10-59814851  
General E-mail: [info@phase2china.com.cn](mailto:info@phase2china.com.cn)

## **MEXICO**

### **Phase II de Mexico**

Calle A No. 4 Promer Piso  
Col. San Marcos Azcapotzalco  
C.P 02020 Mexico  
Tel: 011-525-5538-39771  
Fax: same  
General E-mail: [phase2mexico@hotmail.com](mailto:phase2mexico@hotmail.com)

## **VENEZUELA**

### **Phase II Herramientas Universales EDCM. CA.**

Av. Francisco Lazo Marti CC  
Plaza Santa Monica PB Local  
Santa Monica, Caracas 1040 Venezuela  
Tel: 212-690-28-21  
Fax: 212-693-29-16  
E-mail: [edcphm@movistar.net](mailto:edcphm@movistar.net)